

ADVANCE SHIPPING NOTICE

Page 1 of 2

Delivery Number	Packing Slip Number	Date Shipped
1220434	YSI-359212	17-JUN-14
Shipped Via: FEDEX-Truck-Ground		
Tracking Number(s): 609456829362		

SOLD TO

MBARI
7700 SANDHOLDT ROAD
MOSS LANDING, CA 95039, United States

Customer Email: chuffard@mbari.org

SHIP TO

MBARI
7700 SANDHOLDT ROAD
MOSS LANDING, CA 95039, United States

PO NO.	ORDER LINE NO.	YSI ITEM NO.	DESCRIPTION	QTY SHIPPED	UOM	ORDER NO.
1410946	2.1	ROPTODE	Repair,Optode MODEL: 3830 SN: 799 REPORTED SYMPTOM: NOT COMMUNICATING CONSISTENTLY. TECHNICIAN NOTES: -FOUND SUBSTANTIAL CORROSION INSIDE MBARI COMMISSIONED ADAPTER. CORROSION LIKELY CAUSED BY CONDENSATE INSIDE ADAPTER HOUSING (NO DESSICANT PRESENT). ALL O-RINGS INTACT. -REPLACED OPTODE SENSOR FOOT (PART# 3964466) AND 2X 10 PIN LEMO CONNECTORS (PART# 1560064) TO RESTORE OPTODE FUNCTION, COMMUNICATIONS. -PERFORMED VISUAL INSPECTION OUTER HOUSING OK. FOIL HAS DULL, WORN APPEARANCE. REPLACED FOIL WITH PART# 1206005C, RECALIBRATE. -CHECKED FOR ISOLATION BETWEEN HOUSING AND ELECTRONICS. CURRENT CONSUMPTION IN SPEC. -CHECKED FIRMWARE VERSION – OLD = 3.7. UPDATED TO VERSION 3.24. -CALIBRATED SENSOR: DO REPORTS 103.9% DO IN 103.5% BATH. TEMP REPORTS 9.94 DEG C IN 9.97 BATH. FINAL TEST - MEETS AADI SPECS	1	EA	653296
1410946	4.1	ROPTODE	Repair,Optode MODEL: 3830 SN: 801 REPORTED SYMPTOM: CORROSION ON SENSOR TECHNICIAN NOTES: -FOUND SUBSTANTIAL CORROSION ON EXTERNAL FOIL SECURING PLATE AND SCREWS, INSIDE MBARI COMMISSIONED ADAPTER. CORROSION LIKELY CAUSED BY LOSS OF SENSOR GROUND. ALL O-RINGS INTACT.	1	EA	653296

-For terms and conditions refer to WWW.YSI.COM/TERMS_CONDITIONS

-These commodities, technology or software were exported from the United States in accordance with the Export Administration Regulations. Diversion contrary to U.S. law is prohibited.





1700/1725 Brannum Lane
Yellow Springs OH 45387
USA
tel: 937-767-7241
fax: 937-767-9320

YSI
SonTek
Aanderaa
WaterLog / DAA
MJK

ADVANCE SHIPPING NOTICE

Page 2 of 2

Delivery Number	Packing Slip Number	Date Shipped
1220434	YSI-359212	17-JUN-14
Shipped Via: FEDEX-Truck-Ground		
Tracking Number(s): 609456829362		

SOLD TO

MBARI
7700 SANDHOLDT ROAD
MOSS LANDING, CA 95039, United States

Customer Email: chuffard@mbari.org

SHIP TO

MBARI
7700 SANDHOLDT ROAD
MOSS LANDING, CA 95039, United States

PO NO.	ORDER LINE NO.	YSI ITEM NO.	DESCRIPTION	QTY SHIPPED	UOM	ORDER NO.
			-REPLACE OPTODE SENSOR FOOT (PART# 3964466) AND 2X 10 PIN LEMO CONNECTORS (PART# 1560064) TO RESTORE GROUND, ELIMINATE CORROSION. -PERFORMED VISUAL INSPECTION OUTER HOUSING OK. FOIL HAS DULL, WORN APPEARANCE. REPLACE FOIL WITH PART# 1206005C, RECALIBRATE. -CHECKED FOR ISOLATION BETWEEN HOUSING AND ELECTRONICS. CURRENT CONSUMPTION IN SPEC. -CHECKED FIRMWARE VERSION – OLD = 3.7. UPDATED TO VERSION 3.24. -CALIBRATED SENSOR- SENSOR REPORTS 103.6% DO IN 103.7% BATH. TEMP REPORTS 10.00 DEG C IN 9.97 DEG C BATH. FINAL TEST - MEETS AADI SPECS			

-For terms and conditions refer to WWW.YSI.COM/TERMS_CONDITIONS

-These commodities, technology or software were exported from the United States in accordance with the Export Administration Regulations. Diversion contrary to U.S. law is prohibited.

