

HVD9100 Version & Contents

Version			The main contents of revision
Integration	Download	Base	
01.00	01.00	01.00	First release
01.50	01.50	01.00	1) Fixed the bug of BISS interconnectivity with the other company's decoder. 2) The bug that the image falls into disorder when it begins to output the image with BISS(MODE-E) is corrected. 3) The bug that stops while the decipherment is operating is corrected. 4) The bug that the voice output becomes a no sound when the decipherment begins is corrected. 5) The bug of the green screen output condition is corrected. 6) The bug of SNR is corrected.
02.00	02.00	03.00	1) Addition of video format 1080I25/720P50/720P59. 94/720P60/576I25. 2) The bug of Ancillary is corrected.(ANCILLARY stops momentarily every about 13 hours.) 3) Addition of TS over IP. (optional) 4) Addition of audio channel.(+8ch) (optional) 5) At most 4 of audio PES data can be received. 6) Addition of MPEG1 (mono/dual-mono)audio. 7) Received AUDIO - PID can be chosen. 8) Addition of ancillary user definition data. 9) Addition of external LTC. 10) Addition of video format for SMPTE334M. 11) Correction of the threshold value of a temperature sensor. 12) Addition of TRAP customize.
02.20	02.20	04.00	1) It repaired due to decode processing performance shortage.
02.40	02.20	04.00	1) Main board was repaired since there was a problem in the SDI output characteristic.
02.50	02.50	04.00	1) For Low latency decode. 2) Ancillary of the decode object could be arbitrarily selected. 3) The trouble that the decode processing stops after of the error stream receiving was corrected. 4) When bit rate 640Kbps of AAC do receiving, the trouble behind which the decode starting was uncommonly delayed was corrected. 5) When GENLOCK of 720P was operated, the trouble that required time until operating with stability was corrected. 6) The mistake within the range of specification of the stream port number is corrected by the setting from SNMP. 7) The trouble that the fourth packet in decode of ARIB B23 becomes illegal was corrected. 8) The trouble that was not able to be recognized uncommonly when the ARIB B22 do receiving was corrected. 9) The trouble to which the password for the browser access was changed was corrected at the parameter setting change from SNMP. 10) The trouble where "IIC BUS ERROR" occurred when the error happened frequently was corrected. 11) The trouble that a part of log deleted when information of the time of the log was not the order of the record was corrected.

Notes 1. "an integrated version" is the version for management included to mechanisms, such as a case of equipment, and internal wiring.

Notes 2. "a download version" can be checked by the version display of an equipment operation menu, and builds main encoder ability, such as PLD/firmware.

Notes 3. "a base version" shows versions, such as a monitor program for firmware starting for control.