




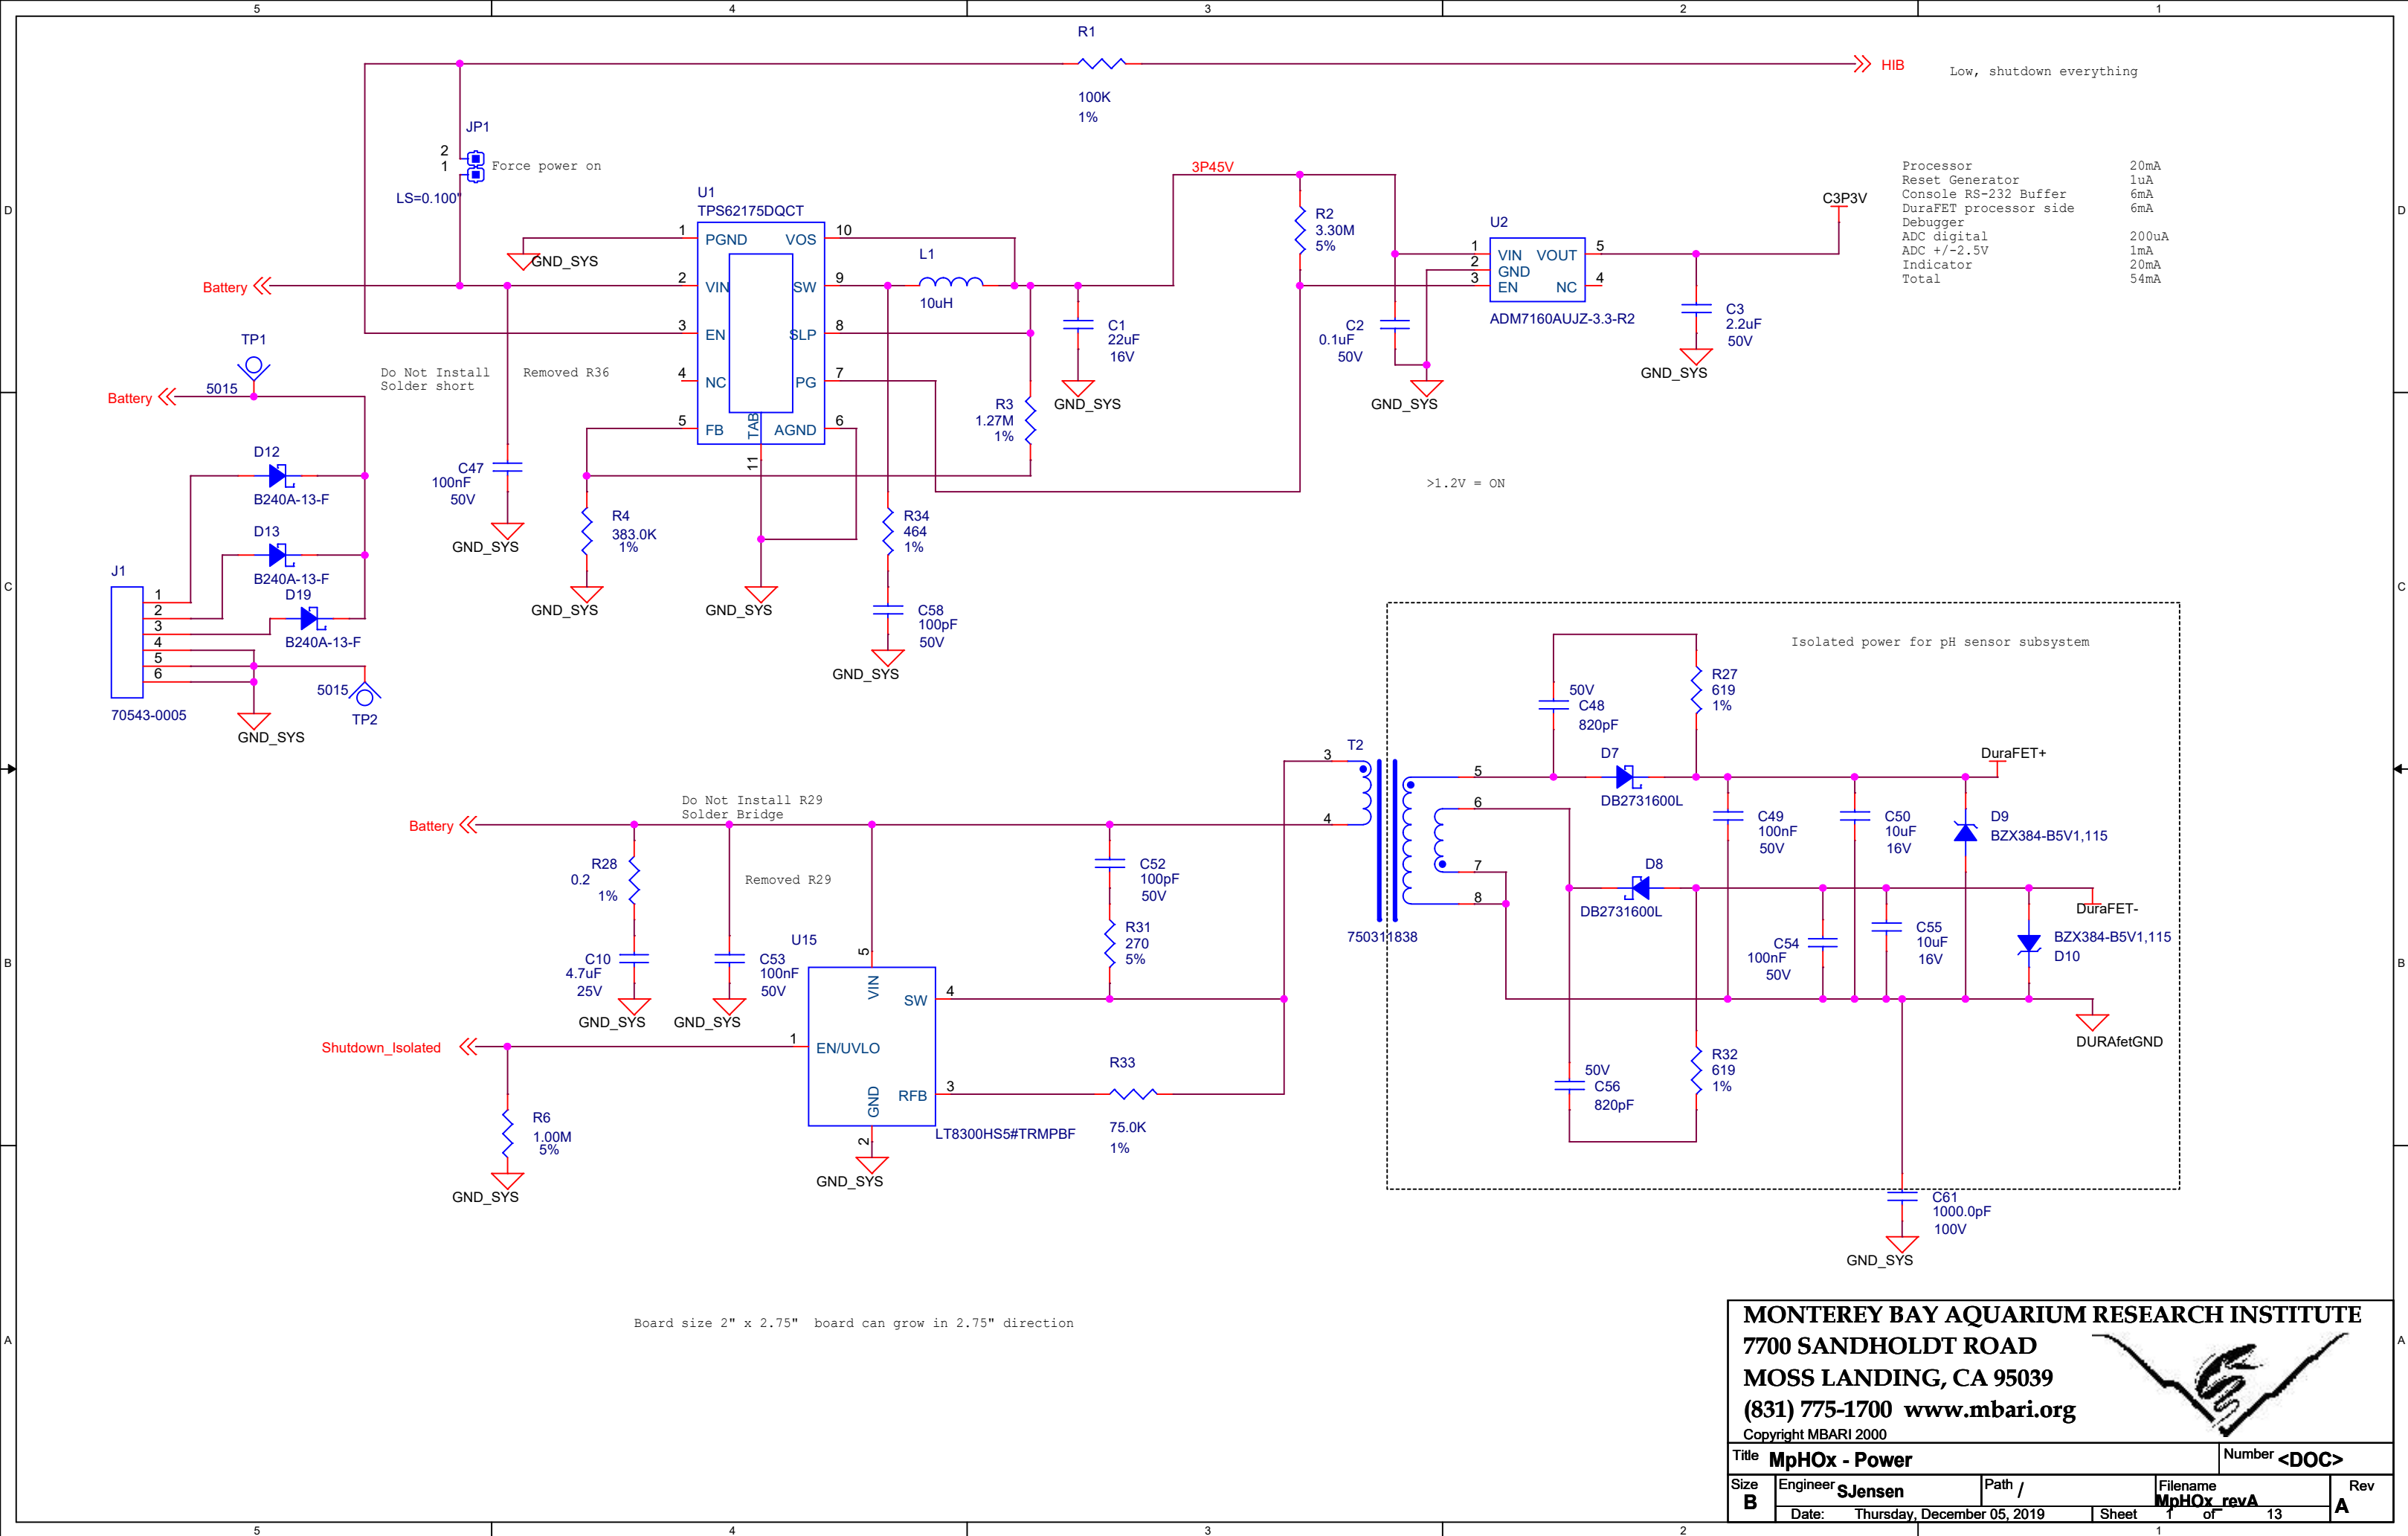


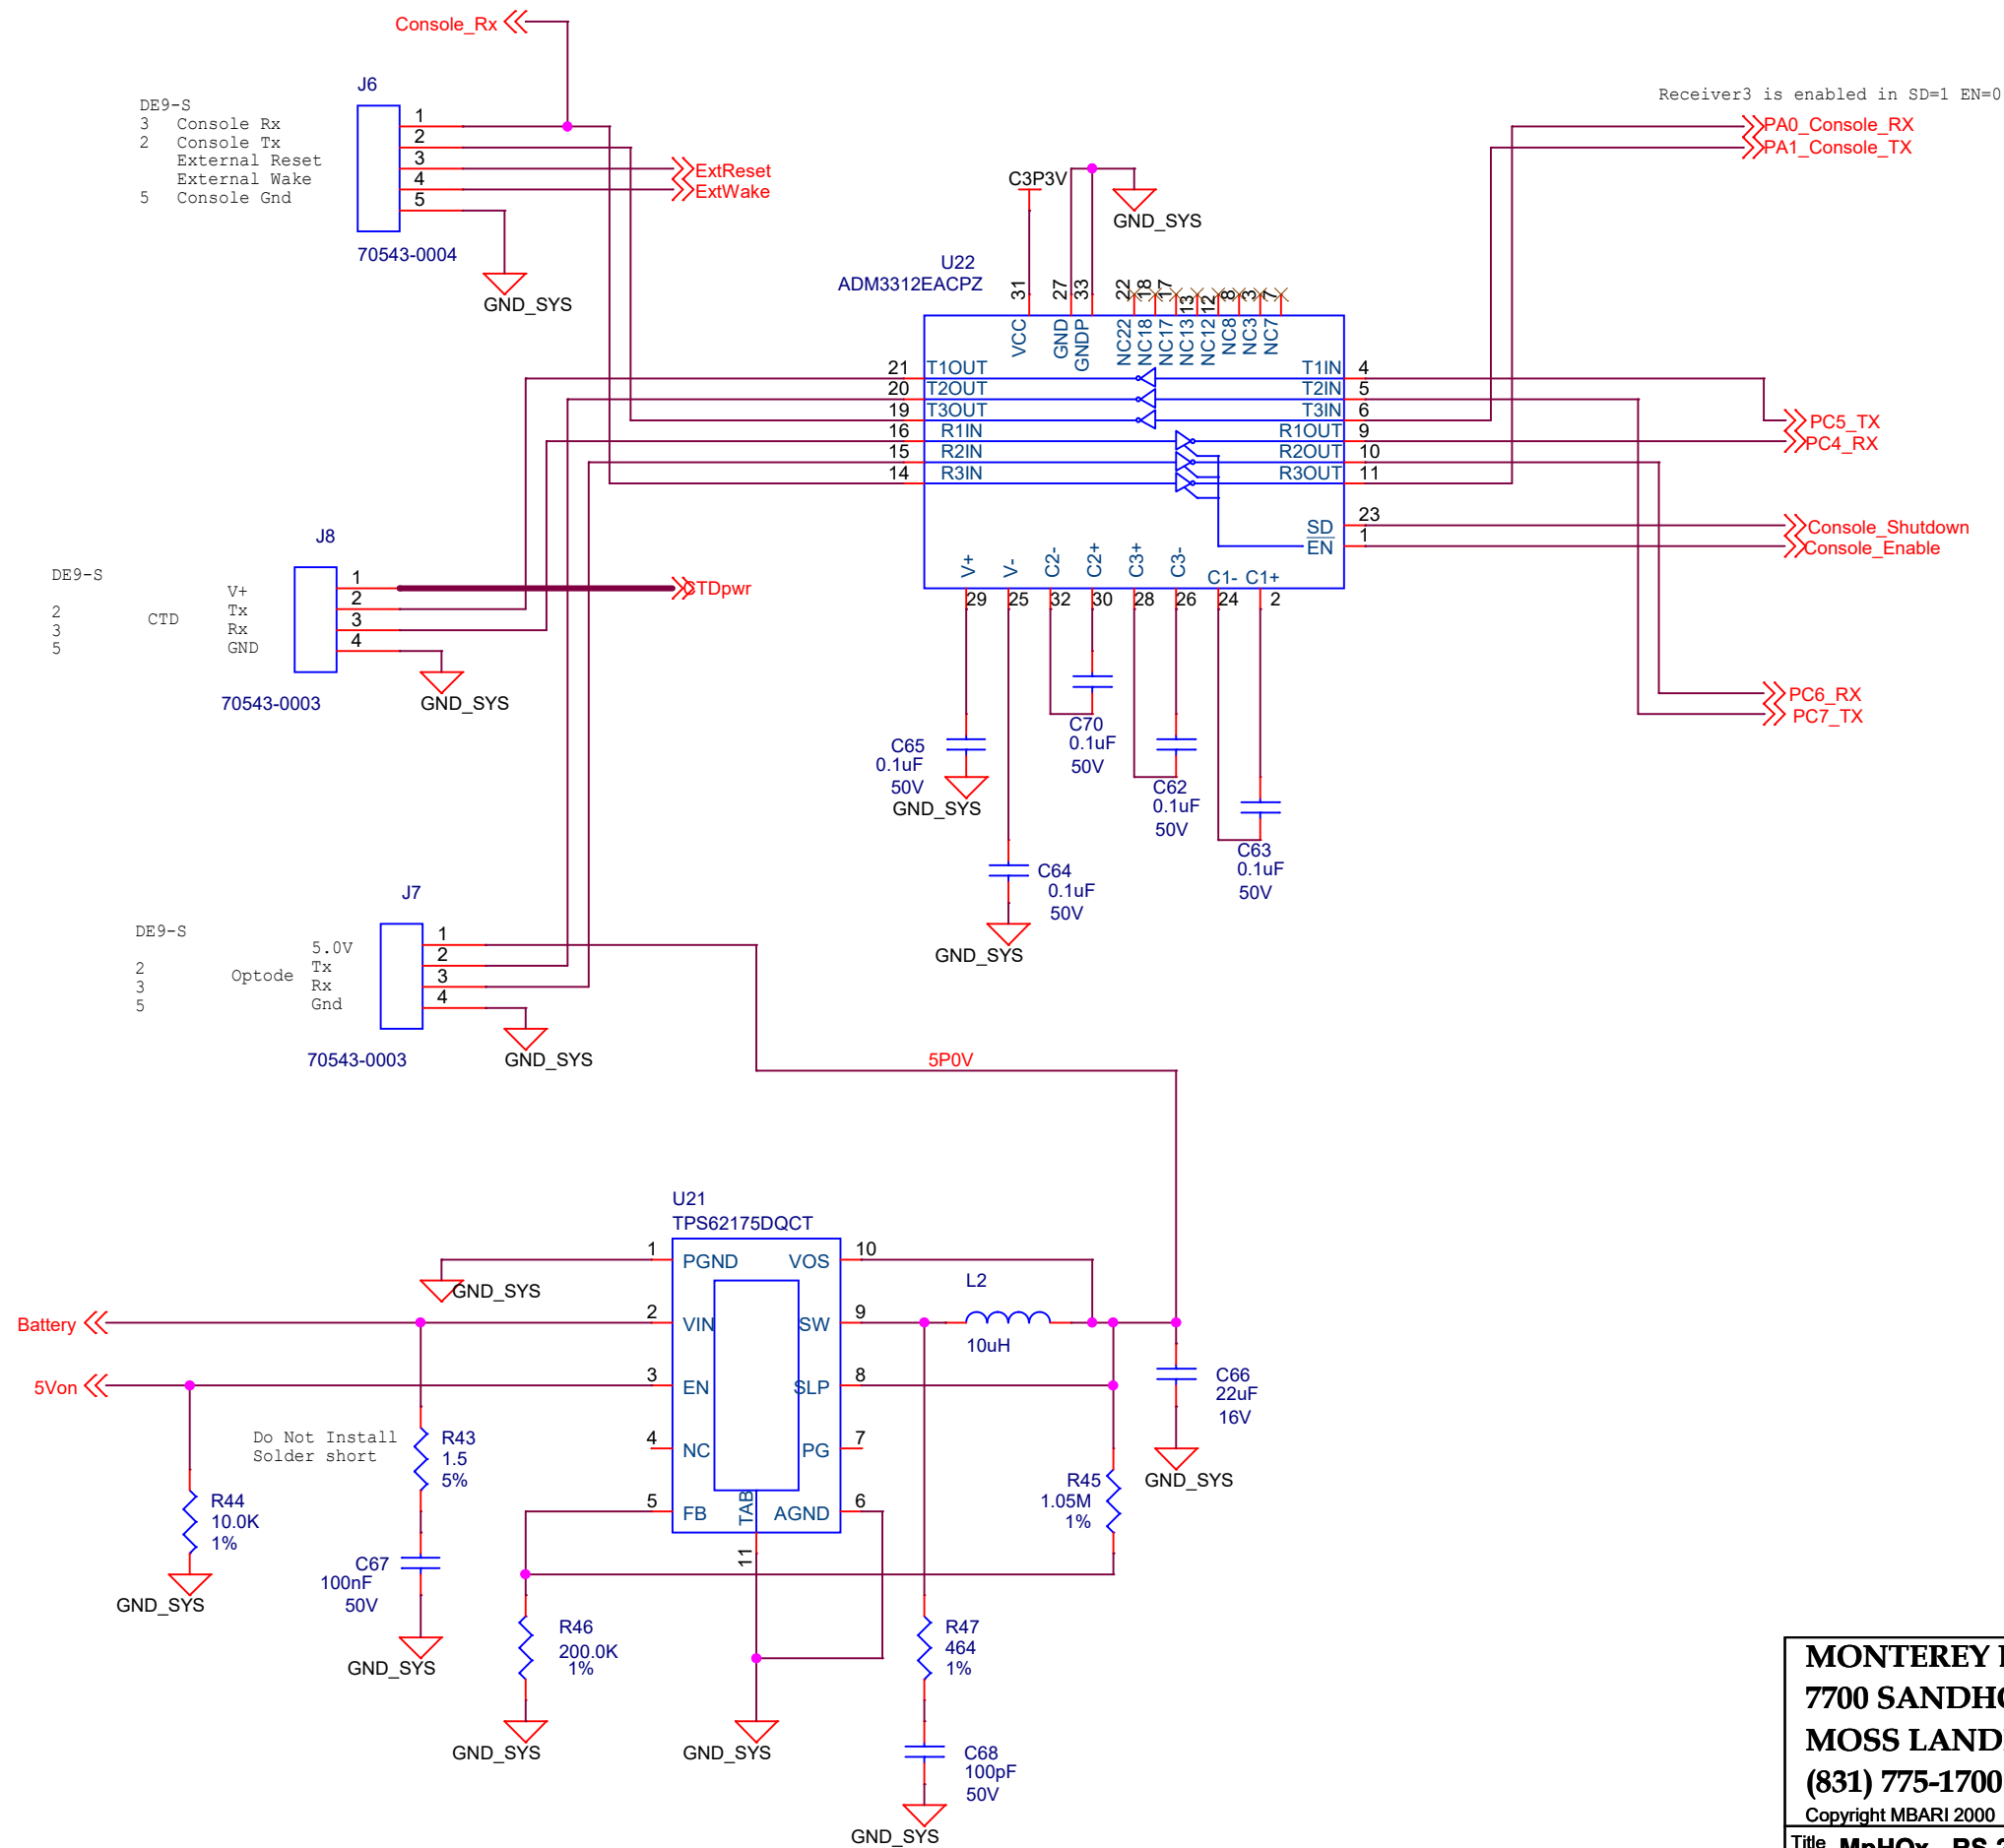

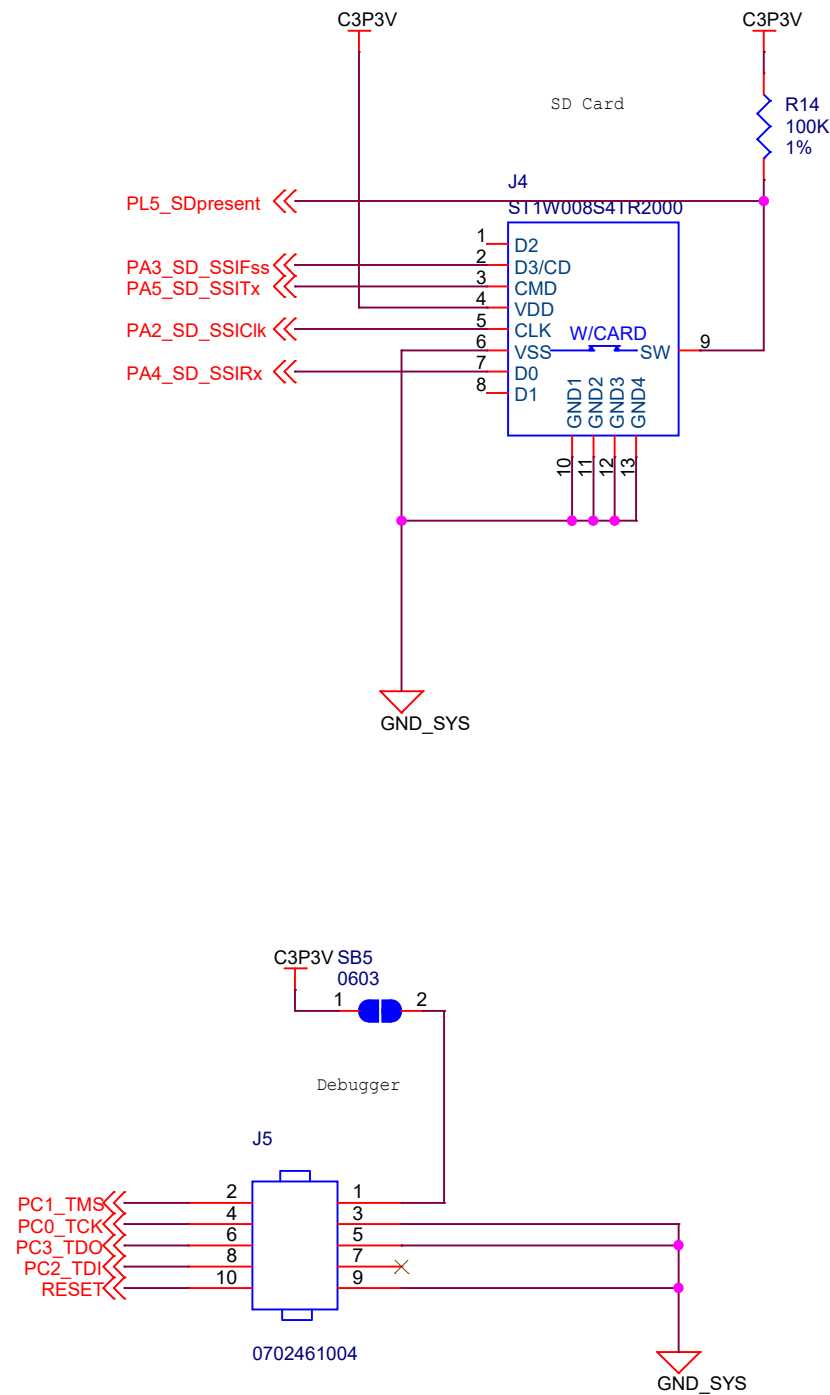

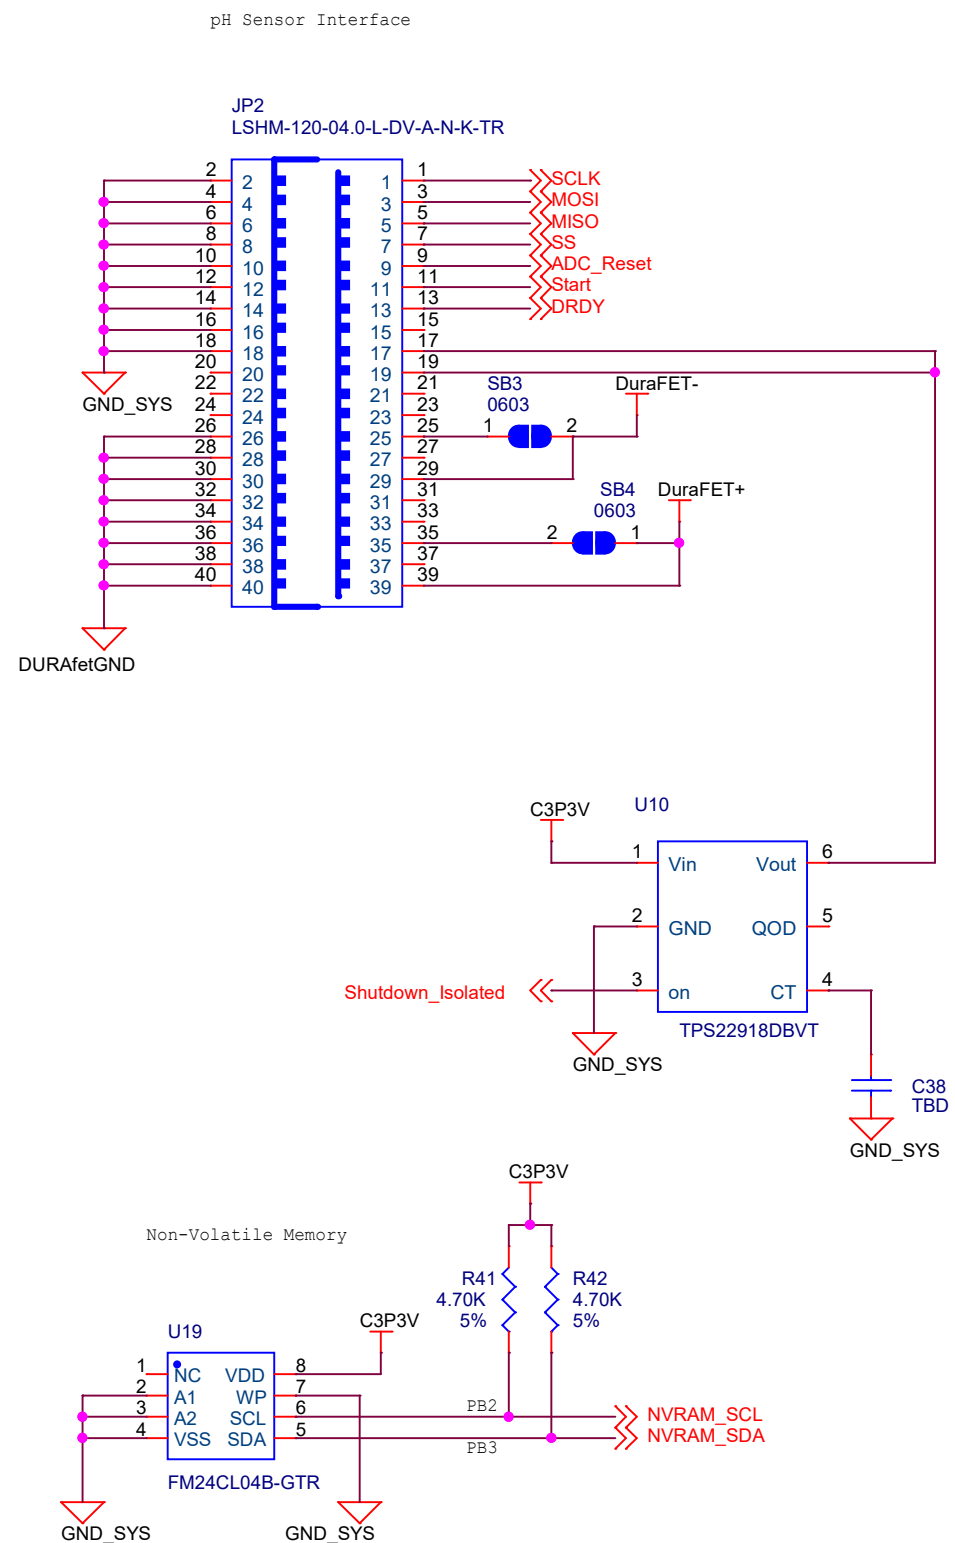

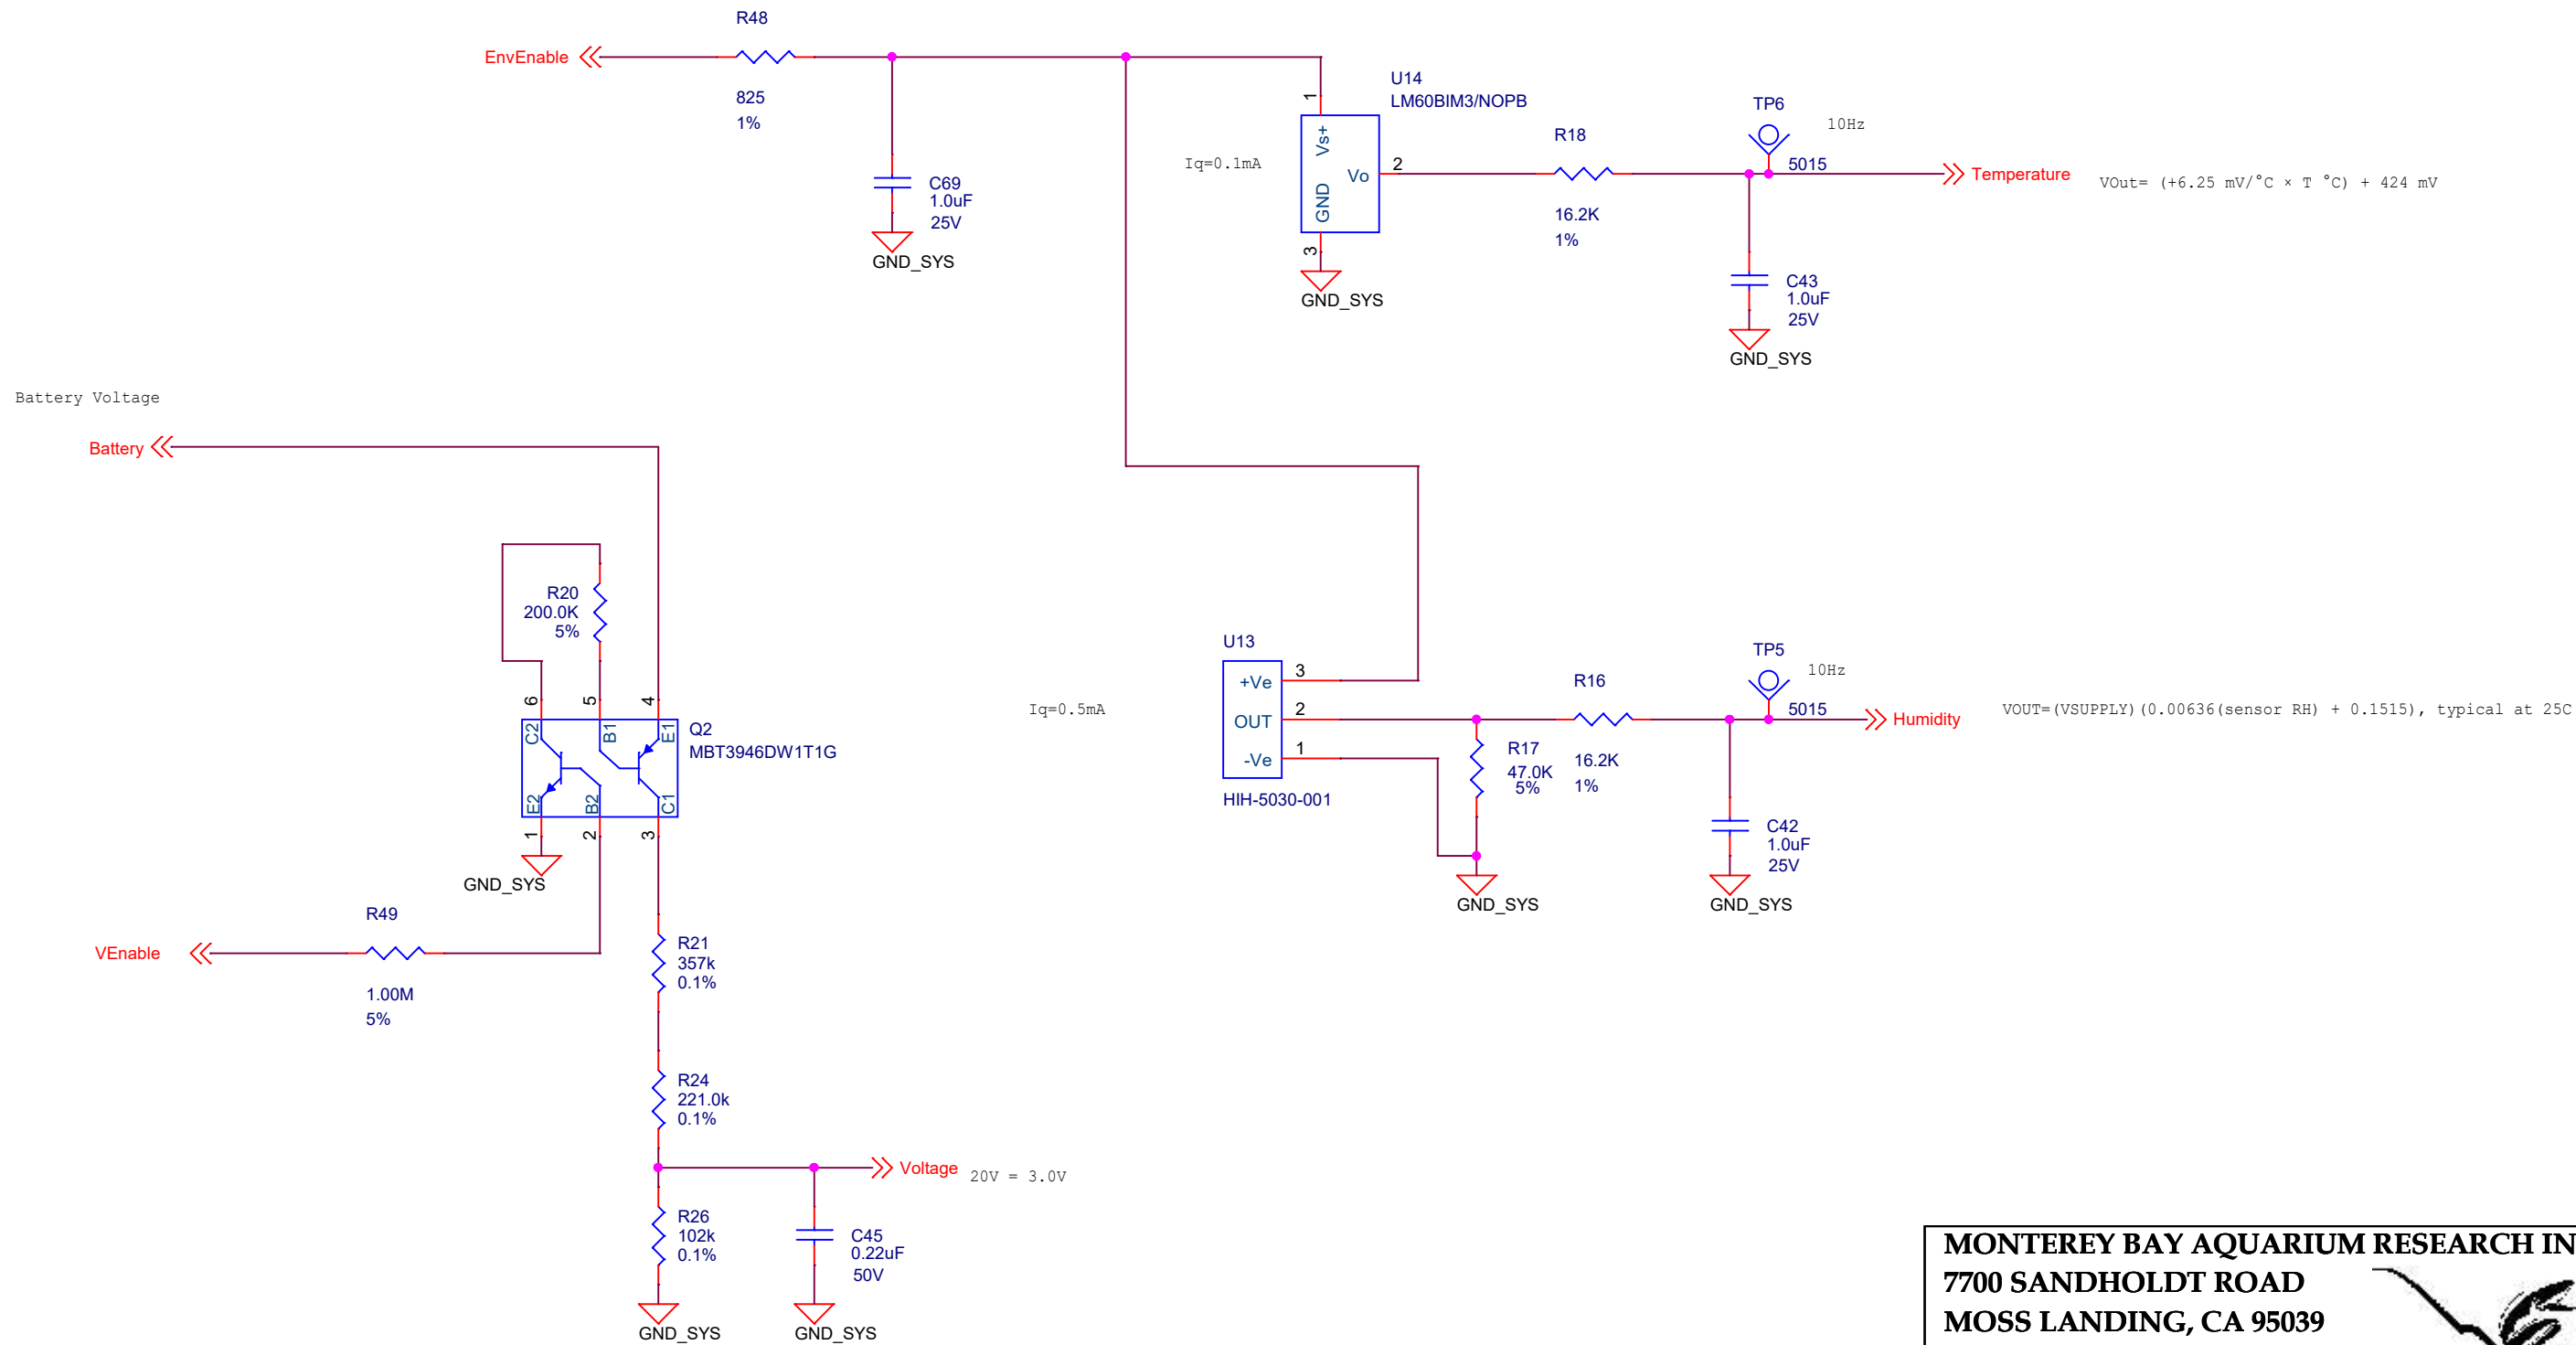

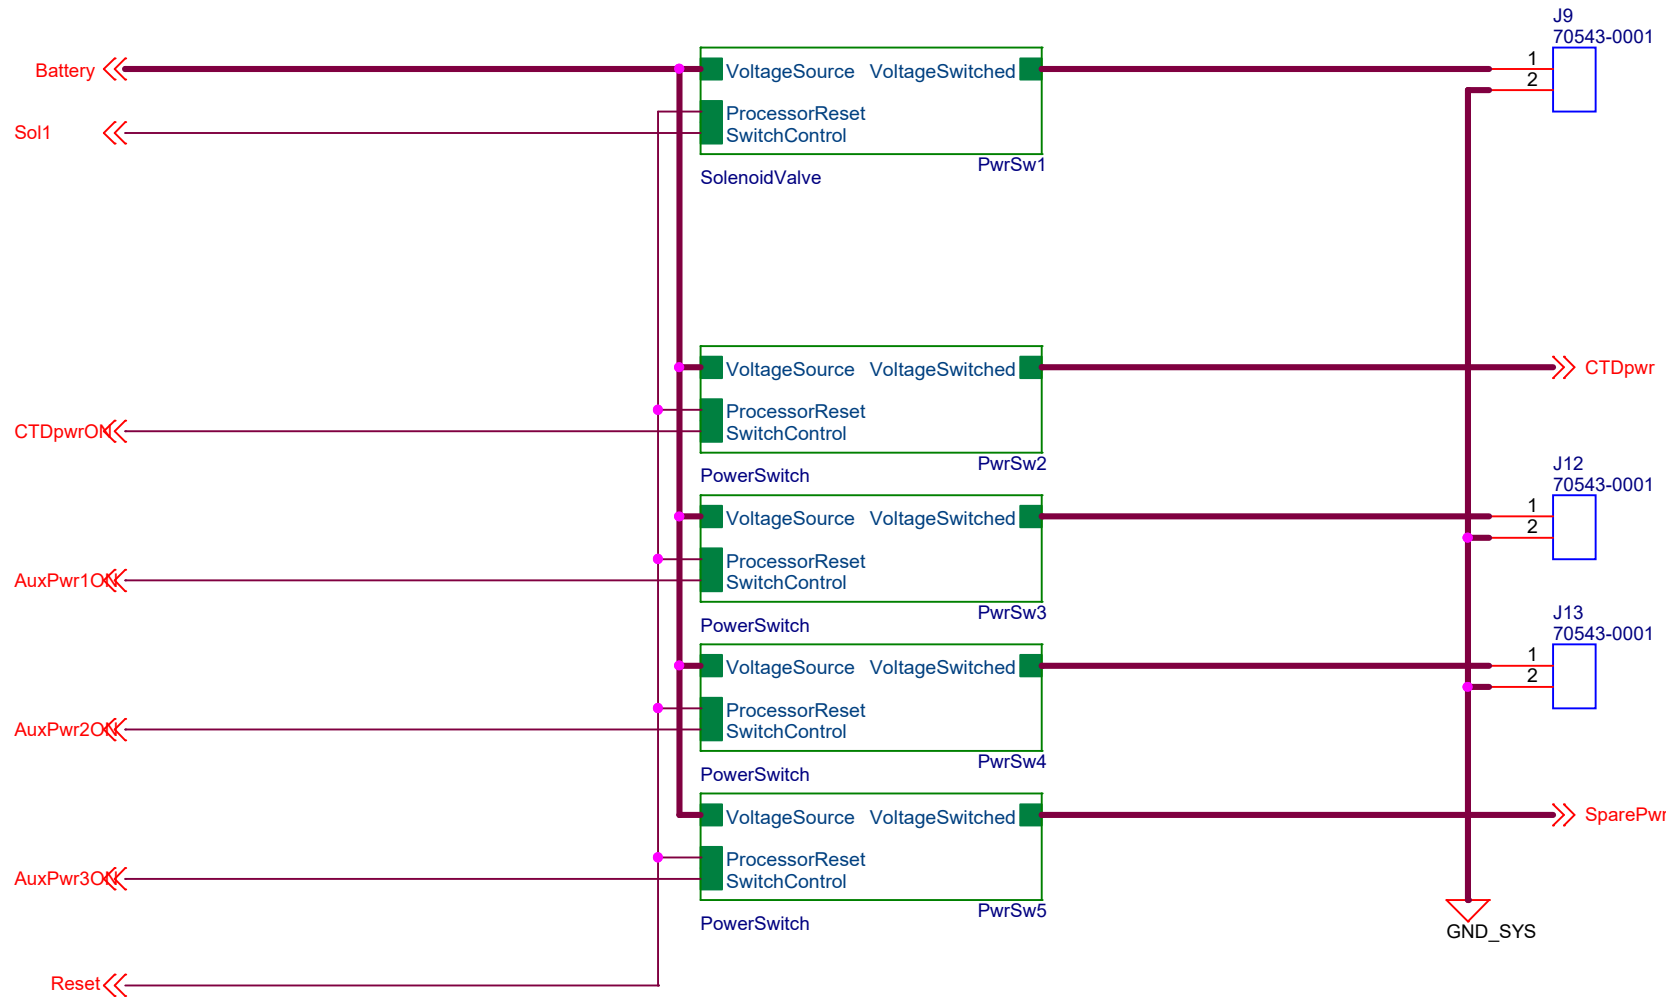

<DOC>

MONTEREY BAY AQUARIUM RESEARCH INSTITUTE

7700 SANDHOLDT ROAD

MOSS LANDING, CA 95039

(831) 775-1700 www.mbari.org

Copyright MBARI 2000



Title **MpHOx Power Switches**

Number

Size **B**

Engineer **SJensen**


Path /

Filename **MpHOx_revA**

Rev **A**

Date: Thursday, December 05, 2019

Sheet 8 of 13

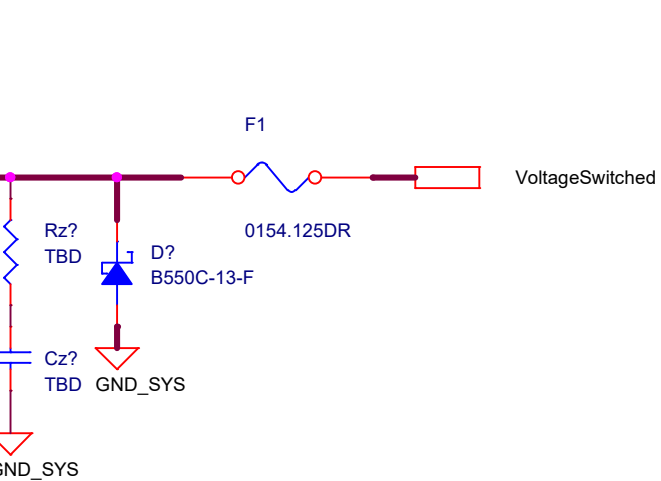

Falling edge cause fast shutdown pulse timed by $R_r * C_r$ and executed via R_u

High = ON

Active Low, when Processor reset is active control pins are tri-stated. This line causes a fast shutdown of switch.

