

Test Results

Description: These tests were all conducted with CPFp3 Test on the prototype build, on the far section of the MBARI dock.


In Housing, 9600V110 in Housing

Result Code	Count	Code Value
Success	10	0
Connect No Login	0	0
Connected Dropped Socket	3	0
No Carrier	37	0
Test Error	0	0

Start Time: 12:42
End Time: 13:11
Duration: 0:29

Total Tests: 50

Trident / Elex In Housing 9600V110

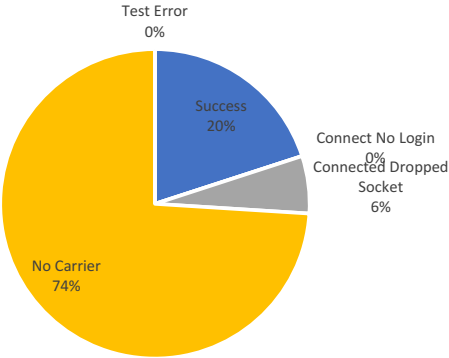


In Housing, 4800 in Housing

Result Code	Count	Uncommitted
Success	7	0
Connect No Login	3	0
Connected Dropped Socket	2	0
No Carrier	18	0
Test Error	0	20

Start Time: 13:18
End Time: 13:44
Duration: 0:26

Total Tests: 50

Trident / Elex in Housing 4800

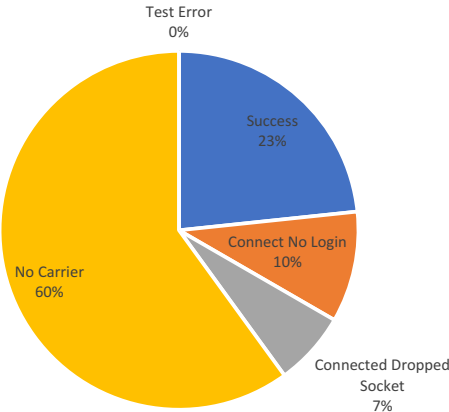


Out of Housing 4800V110

Result Code	Count	Uncommitted
Success	34	0
Connect No Login	0	0
Connected Dropped Socket	12	0
No Carrier	3	0
Test Error	0	1

Start Time: 13:49
End Time: 14:29
Duration: 0:40

Total Tests: 50

Trident / Elex Out of Housing 4800 V110

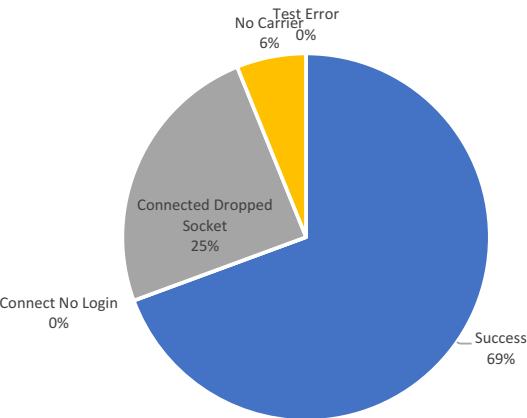


Trident / Elex in Housing 4800V110 (Test for fluke)

Result Code	Count	Uncommitted
Success	9	0
Connect No Login	0	0
Connected Dropped Socket	5	0
No Carrier	4	0
Test Error	0	7
	0	0

Start Time: 14:30
End Time: 15:12
Duration: 0:42

Total Tests: 25

Trident / Elex in Housing 4800V110 (Test for fluke)

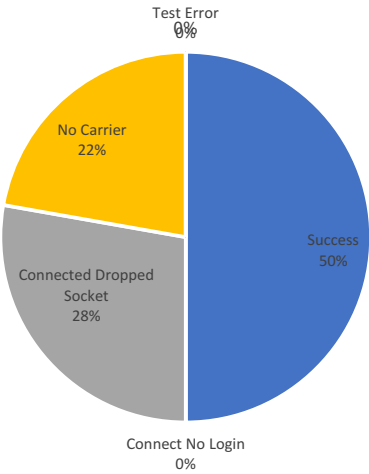


Trident / Elex in Housing 4800V110 Plastic Stem

Result Code	Count	Uncommitted
Success	11	0
Connect No Login	0	0
Connected Dropped Socket	8	0
No Carrier	12	0
Test Error	0	0
	0	0

Start Time: 15:19
End Time: 15:43
Duration: 0:24

Total Tests: 31

Trident / Elex in Housing 4800V110 Plastic Stem

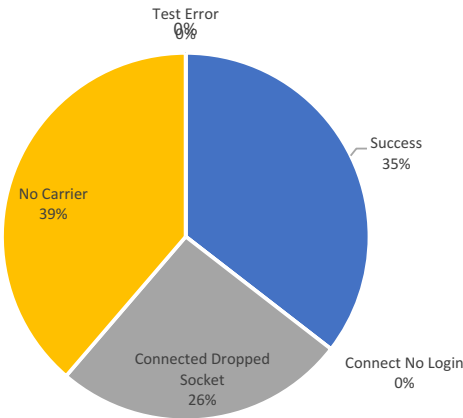


MRV / Elex in Housing 4800V110

Result Code	Count	Uncommitted
Success	30	0
Connect No Login	1	0
Connected Dropped Socket	12	0
No Carrier	6	0
Test Error	0	1
	0	0

Start Time: 16:10
End Time: 16:49
Duration: 0:39

Total Tests: 50

MRV / Elex in Housing 4800V110

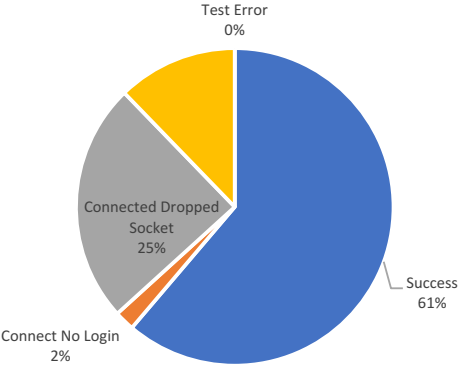

Test	Test Number
Triton in Housing, 9600V110	1
Triton in Housing, 4800	2
Triton Out of Housing 4800V110	3
Triton in Housing 4800V110	4
Titon in Housing Plastic Stem 4800V110	5
MRV in Housing 4800V110	6

