


REVISIONS			
ZONE	DESCRIPTION	DATE	APPROVED
-	--	XX/XX/XX	XX/XX/XX
-	--	XX/XX/XX	XX/XX/XX


NOTES:

1. ITEMS 1-6 CAN BE REPLACED WITH A PRE-ASSEMBLED VENDOR CABLE. USE SUBCONN PN TBD OR EQUIVALENT, NDBC CONTROL # 8459.
2. USE A BROTHER P-TOUCH LABEL MAKER, MODEL PT-2400 OR EQUIVALENT, TO IDENTIFY CABLES AS SHOWN IN THE LABEL IDENTIFICATION TABLE. APPLY LABELS AS SHOWN IN THE CABLE VIEW.
3. EQUIVALENT SUBSTITUTE CAN BE USED IN PLACE OF SPECIFIED ITEM.

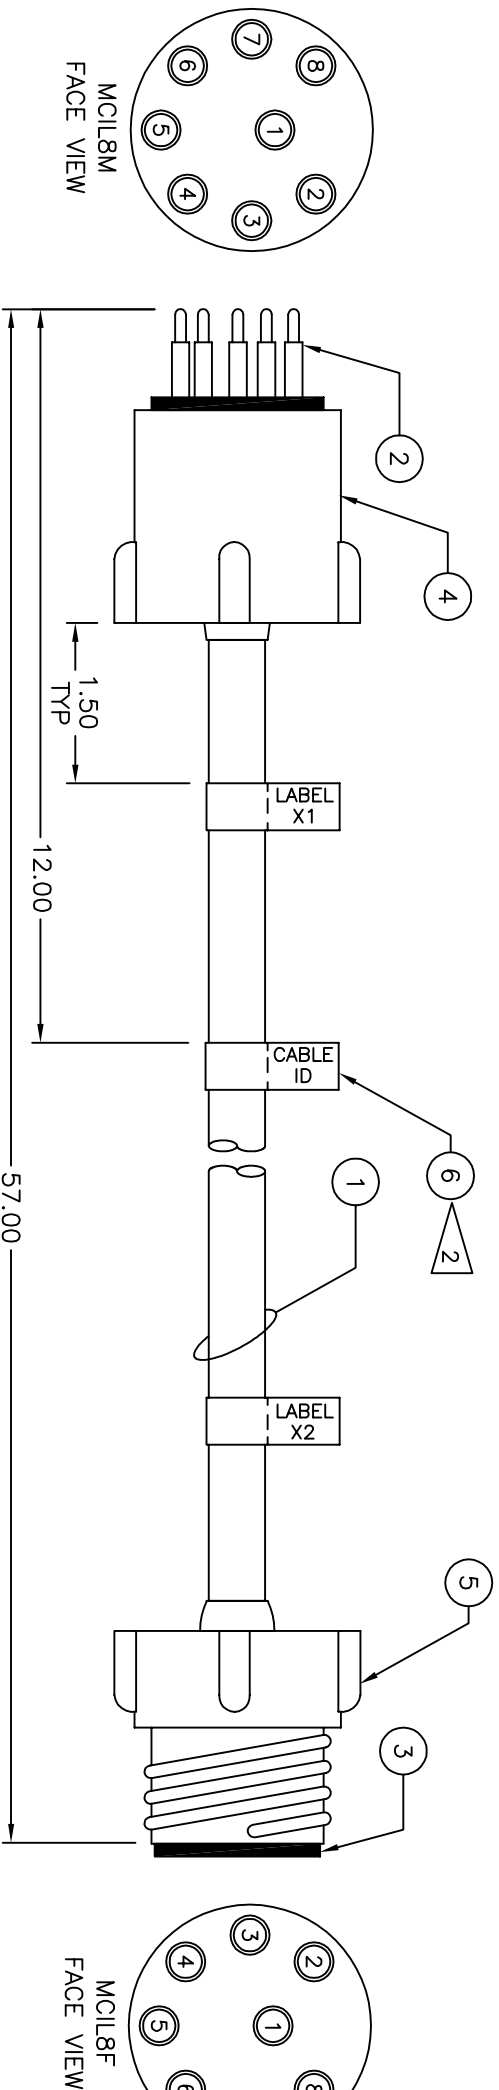

AM TRANSDUCER PASS-THRU CABLE ASSEMBLY -001

LABEL IDENTIFICATION TABLE		
CABLE ID NUMBER	LABEL X1	LABEL X2
02.3F03114-001	PASS THRU 1P1 OR 4P1 AM PASS IN	PASS THRU 1J2 OR 4J2 AM PASS OUT

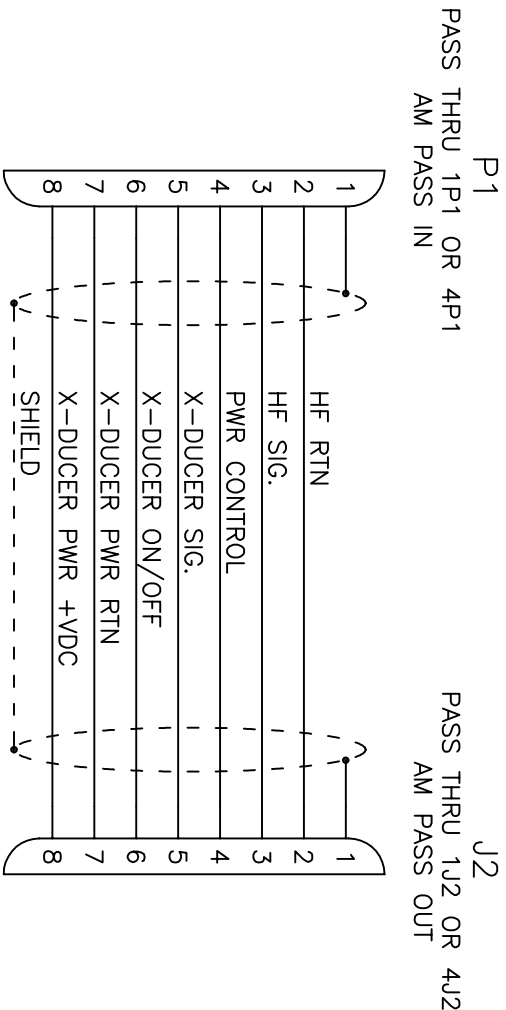

AM TRANSDUCER PASS-THRU CABLE WIRING -001

PARTS LIST							
QTY	NOTES	DESCRIPTION	NBCC CONTROL NO.	MANUFACTURER & PART NUMBER	ZONE (S)	ITEM NO.	
—	AR	2	LABEL TAPE, BLK INK ON WHT 9mm(3/8"), P-TOUCH TZ LAMINATED TAPE	14177	BROTHER TZ-221	D5	6
—	1	3	SLEEVE, CONNECTOR LOCKING, MALE, DELRIN, WITH SNAP RING, WETMATE	—	SUBCONN MCDLSM	D4	5
—	1	3	SLEEVE, CONNECTOR LOCKING, FEMALE, DELRIN, WITH SNAP RING, WETMATE	—	SUBCONN MCDLSF	D7	4
—	1	3	CONNECTOR, WET MATE 8 CIRCUIT, FEMALE, CABLE END	—	SUBCONN MCL18F	D4	3
—	1	3	CONNECTOR, WET MATE 8 CIRCUIT, MALE, CABLE END	—	SUBCONN MCL18M	D7	2
—	AR	3	CABLE, 7 CONDUCTOR MIN, SHIELDED, ZOAWG, POLYURETHANE JACKET	NSN	ALPHA WIRE 25158	C5	1
—002 —001							

[illegible]

AutocAD Drawing/Sketch:
Printed Copies May Be Obsolete
Validate Prior to use.